

## **FGV-H Series Digital Force Gauges Models FGV-200H,300H,500H**

## **Instruction Manual**



### **General**

You have just received one of the world's smallest, rugged, economical and versatile force gauges. Its ergonomic design makes this gauge a friendly instrument to the human hand. With just the touch of a button you can measure force in any engineering units desired, i.e. lbs, kgs or N. Any force from a few oz. up to 500 lbs can be accurately measured with one of the FGV family gauges. This series offers an RS232C and an analog output port for further processing the displayed measurements.

The unit's microprocessor enables it to measure forces very accurately in the "average" or "peak" mode. Its LCD display is smartly designed to inform the operator at all times of exactly what is going on.

If the hanger is used or a test stand, reversing the display so that it can be read right-side-up is a cinch. Just press two buttons and the digits and units indicators reverse themselves instantly.

### **Precautions**

Do not use the gauge in hostile environments.

- A. High humidity areas
- B. High temperature environments  
(see specifications table)
- C. Caustic areas where various chemicals can seep into the unit.

When not in use, place gauge back in its case to prevent any damage due to an accidental drop etc. With a little care you can have an instrument that can last and provide service for many years.

### **Operation**

When the carrying case is opened make sure you have all the accessories that come with the instrument.

1. Charge the batteries for approx. 12 hrs. before using the gauge (Batteries come discharged from the factory).  
When batteries are charging the BAT indicator is ON.  
When the batteries are fully charged the indicator goes OFF.
2. Hand tighten appropriate attachment to unit's measuring shaft (Do not use a wrench or any other device to tighten the attachment).
3. Press the POWER switch and release. On the release of the switch the display will momentarily show all 8's (Digit segment self-check) and then will show some zeros with the last one or two digits changing to some random numbers. Also the unit of measurement (lbs, kgs or N) will appear above the digits and stay as long as the instrument is on.

### **Change Display Units**

To change the display units, just press the UNIT button and the units will change every time this particular button is pressed.

## **Reverse the Display**

If unit is used with the hanger or mounted on a test stand and the display must be reversed, follow this procedure:

1. Press the POWER switch and hold it. Display will go blank.
2. Press UNIT switch and hold it.
3. Release POWER switch while you are still holding the UNIT switch. Display is still blank.
4. Press the POWER switch once more and release it while still holding the UNIT switch. At this point you should see the display reversed.
5. Release the UNIT switch. Now the display stays in that mode. If you want to go back to the normal mode just repeat steps 1 through 5.

## **Select Average or Peak**

If you want to measure force in real time the display will show just the digits and units of the force being measured. That is "average" force. If you want to measure "peak" force, press the PEAK button and the word PEAK will appear in the upper left corner of the display. When the unit is in the peak mode, the display will freeze after capturing the peak force. Press zero to cancel previous peak and continue with your tests. If you want to go back to average mode press the PEAK button again and the word PEAK will disappear from the display.

**NOTE:** It is very important that you measure forces (tension or compression) that are in line with the measuring shaft and not at any angle (see fig. 1). Failure to observe this directive will damage the instrument. Also, after the gauge is positioned and ready to take a measurement (with the proper attachment in place) tare the unit by pressing the ZERO switch. In the PEAK mode to clear the display for another measurement press the ZERO switch.

## **Measure Tension**

To measure tensile force use the hook attachment. The display will show the force measured and a minus sign (-) will appear on the left of the display (right next to the digits).

## **Measure Compression**

To measure compression force use the proper attachment. No sign will appear on the left of the display during a compression measurement.

## **Low Battery**

When the battery charge starts to get low, a LO BAT sign appears in the upper left corner of the display. The gauge will work for another three hours after the indicator appears. At this point, if necessary, the adapter/charger can be used to power the unit indefinitely. With the power off and the battery discharged it takes approx. 12 hrs. to fully charge it. When the battery is fully charged the adapter/charger cuts off completely to protect the battery.

## **Auto Power Off**

If the power on the gauge is turned on and there is no activity for 10 minutes, the power is automatically cut-off to conserve battery charge. One minute before cut-off, the sign PWR appears above the display digits to remind the operator that there is 1 minute left before power cut-off. If the adapter/charger is powering the gauge the Auto Power Cut-off function becomes inactive.

## **Tracking Function**

A tracking function has been introduced to check and compensate for temperature drift. When measuring very minute forces (a few oz.) and at a very slow rate, you may want to turn off the tracking function. To turn off or on the tracking function follow the steps below:

1. Turn power off
2. Press PEAK and UNIT switches simultaneously and hold these until step 3 is complete.
3. Press POWER switch and release it to turn the power on. If tracking function was on, the display will show TRK OFF momentarily.
4. Release buttons PEAK & UNIT. The tracking function is now off. Repeat above steps to turn it on. It is a good idea to have this function on all the time unless it is absolutely necessary to cancel it.

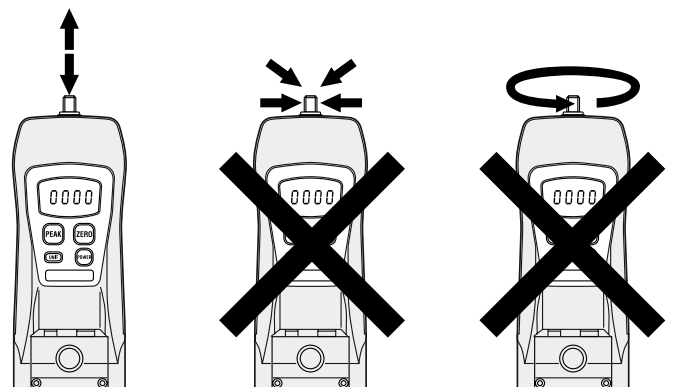


Fig. 1

## Overload

Even though each model is able to withstand an overload of 200% of its rated capacity, caution should be exercised that this does not happen very often otherwise the sensor will be damaged. To protect the gauge and/or the sample under test when a motorized stand or some other motorized device is used in conjunction with the gauge, two overload output OC NPN transistors are available to be used to disconnect power when the overload condition reaches 120% of the gauge's rated capacity. One transistor is for tension and the other for compression. See diagram below (Fig 2).

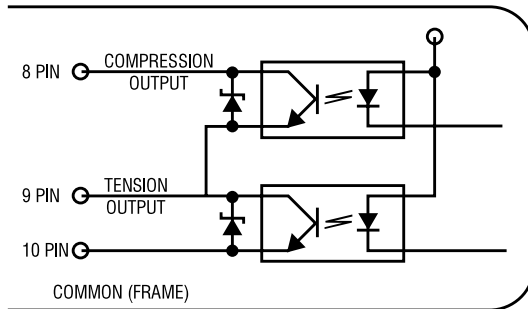


Fig. 2

## Analog Output

An analog output signal is available for recording purposes. The amplitude of this signal is  $\pm 1$  VDC. The voltage is positive when compression testing is performed and negative for tension.

### Signal characteristics:

Amplitude:	$\pm 1$ VDC
Generated by:	12-bit D/A converter
Signal update:	140 times/sec
Load impedance:	10 K $\Omega$ minimum
Connector pins:	Pin #1 signal output (analog) Pin #2 GND (analog) (see Fig.3 & Table 1)

Comment: When the zero switch is pressed to tare the gauge the analog output goes to 0V automatically.

## RS232C Port

The most important feature of the FGV family of gauges is perhaps the availability of the RS232C communications port. Data and commands can be linked to a PC or any other device responding to RS232C signals for storage or further analysis. All activity is taking place through the connector shown in Fig. 3. Table 1 below shows the pins involved with all activity that is taking place through connector HR12-10RC-10SDL shown in Fig. 3.

PIN#	DESCRIPTION
1	Analog signal output
2	Analog GND
3	Receive data (input)
4	Digital GND
5	Communication enable
6	Transmit data (output)
7	No connection
8	Compression overload output
9	Tension overload output
10	Frame GND

Table 1

### RS232C Output Specifications

Baud rate:	2400 bps
Data length:	8 bits
Parity:	none
Stop bit:	one
Logic level:	$\pm 10$ V

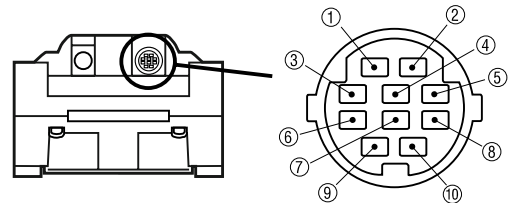


Fig. 3  
(HR12-10RC-10SDL), HIROSE

## Connections

FGV output connector pin#	RS232C connector on PC (D-sub 25pin)
3 (RxD)	2 (TxD)
6 (TxD)	3 (RxD)
4 (GND)	7 (GND)
5 (Enable)	4 (RTS)
	5 (CTS)

## Commands/Responses

The FGV series of force gauges has the ability to recognize and respond to various commands from outside peripherals. If for instance the gauge receives a legitimate command from a PC, it will respond by sending back the same code indicating to the PC that the command was recognized. If for example the command is a request for average data output, it will send the data and the code NA etc. If the gauge recognizes an error while it is receiving a command, an error symbol is transmitted back to the PC indicating the exact nature of the error.

### Commands to FGV Gauge

- AAcr: Tare  
 ABcr: Stop output  
 ACcr: Change to peak mode  
 ADcr: Change to average mode  
 AEcr: Peak reset  
 AFcr: Change units to kg (g)  
 AGcr: Change units to N  
 AHcr: Change units to lb (oz)  
 BAcr: Data output request  
 BBcr: Continuous data output request (10 times/sec)  
 BCcr: Model name confirmation request  
 BDcr: Units confirmation request  
 BEcr: Peak data output request

### Response from FGV Gauge

- NA□□□□□cr: Average data output  
 NB□□□□□cr: Peak data output  
 ┌───┬───┬───┬───┬───┐  
 │ │ │ │ │ │  
 └───┬───┬───┬───┬───┘  
 4-digit number with decimal point  
 sign (+ or -)

- NE□□cr: Model number

02	03	04	05	06	07	08	09
FGV-0.5	FGV-1	FGV-2	FGV-5	FGV-10	FGV-20	FGV-50	FGV-100

- NH□cr: Unit
- |   |        |         |
|---|--------|---------|
| 0 | 1      | 2       |
| N | Kg (g) | lb (oz) |

### Error symbols:

- OBcr: Command error      OFcr: Format error  
 ODcr: Overload error    OGcr: Summing error  
 OEcr: Parity error        OHcr: Overrun error

## Specifications

MODELS	FGV-200H	FGV-300H	FGV-500H
<b>CAPACITY</b>	200.0 lb.	300.0 lb	500.0 lb
	100.0 kg	150.0 kg	250.0 kg
	1000 N	1500 N	2500 N
<b>RESOLUTION</b>	0.1 lb	0.1 lb	0.1 lb
	0.1 kg	0.1 kg	0.1 kg
	1 N	1 N	1 N
<b>ACCURACY</b>	±0.2% FS plus 1/2 digit at 73°F (23°C)		
<b>DISPLAY</b>	4-Digit LCD 12mm high. Reversible by pressing switches. Minus sign for tension.		
<b>AVERAGE/PEAK MODE</b>	Yes (Selectable)		
<b>LOW BATTERY INDICATION</b>	Yes		
<b>DISPLAY UPDATE</b>	0.3 second		
<b>SAMPLING RATE</b>	35 times per second		
<b>OVERLOAD</b>	200% of FS	150% of FS	
<b>POWER</b>	Rechargeable Ni-Cad batteries or AC adapter/charger		
<b>AUTO POWER OFF</b>	10 minutes (not active if AC adapter/charger is in use)		
<b>BATTERY CHARGE</b>	20 hours when battery is fully charged		
<b>RECHARGE</b>	12 hour approx. (over charge protection)		
<b>TEMPERATURE</b>	32° - 104°F (0° - 40°C)		
<b>DIMENSIONS</b>	8.5"L x 3.4"W x 2.2D (214 x 82 x 55mm)		
<b>WEIGHT</b>	2 lb (900g)		
<b>OVERLOAD OUTPUT</b>	One NPN OC transistor for tension, one NPN OC transistor for compression		
<b>ACCESSORIES (INCLUDED)</b>	AC adapter/charger, carrying case, hook, chisel, flat head, notched head, cone head, extension rod, hanger and handles and analog output cable.		
<b>ACCESSORIES (AVAILABLE)</b>	Test stands, RS232C cable, overload output cable		

## Dimensions

All dimensions in mm

